

# TECHNICAL BULLETIN

LTB00661v2  
30 OCT 2014



© Jaguar Land Rover Limited  
All rights reserved.

**This reissue replaces all previous versions. Please destroy all previous versions. This bulletin supersedes TSB LTB00661/2014 dated 07 MAY 2014, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.**

Changes are highlighted in gray

## **SECTION: 501-00**

### 3rd Row Seat Will Not Fold Or Sticks In Operation

#### **AFFECTED VEHICLE RANGE:**

##### **Discovery 3 / LR3 (LA)**

**Model Year:** 2005-2009

**VIN:** 000256-500451

##### **Discovery 4 / LR4 (LA)**

**Model Year:** 2010 Onwards

**VIN:** 510178 Onwards

#### **MARKETS:**

All

#### **CONDITION SUMMARY:**

**Situation:** A customer complaint of when folding up or down the 3rd row seating it is difficult to operate. **This version has been issued for a change to the TOPIx section number and title. Suggested Customer Concern Code BE2.**

**Cause:** The seat operating lever is out of alignment.

**Action:** Should a customer express concern, follow the Service Instruction outlined below.

#### **PARTS:**

No Parts Required

#### **TOOLS:**

No Tools Required

#### **WARRANTY:**

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**


 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Stowage latch - occasional rear seat - rectification	78.85.89.56	0.2	42	HTD500270

 **NOTE: Normal Warranty procedures apply.**

#### **SERVICE INSTRUCTION:**


- Using a suitable tool, release the 3rd row seat latch.

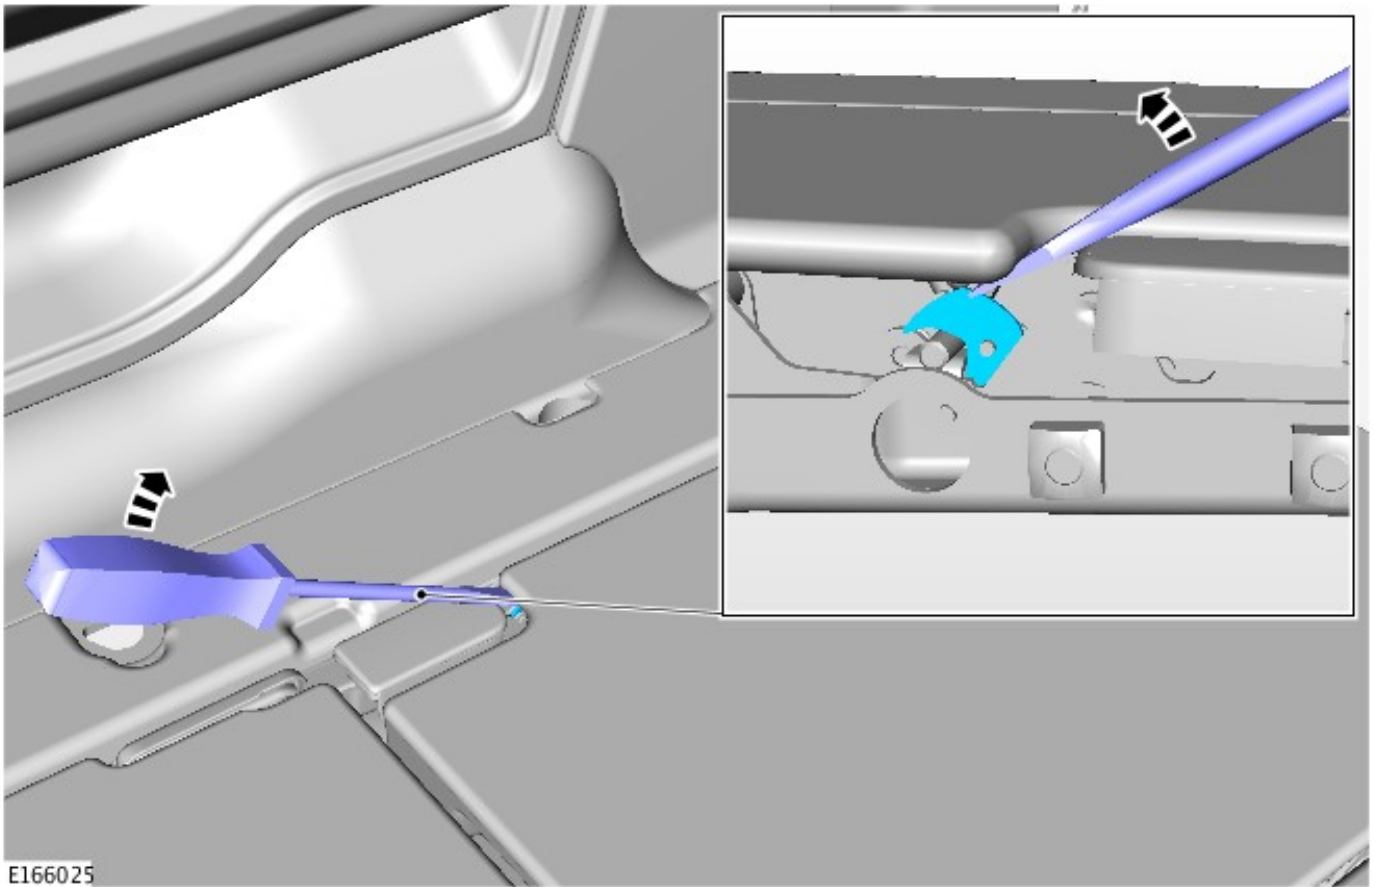

E166025

**2. Inspect the linkage.**

- Using a suitable tool, position the linkage to one side as shown.

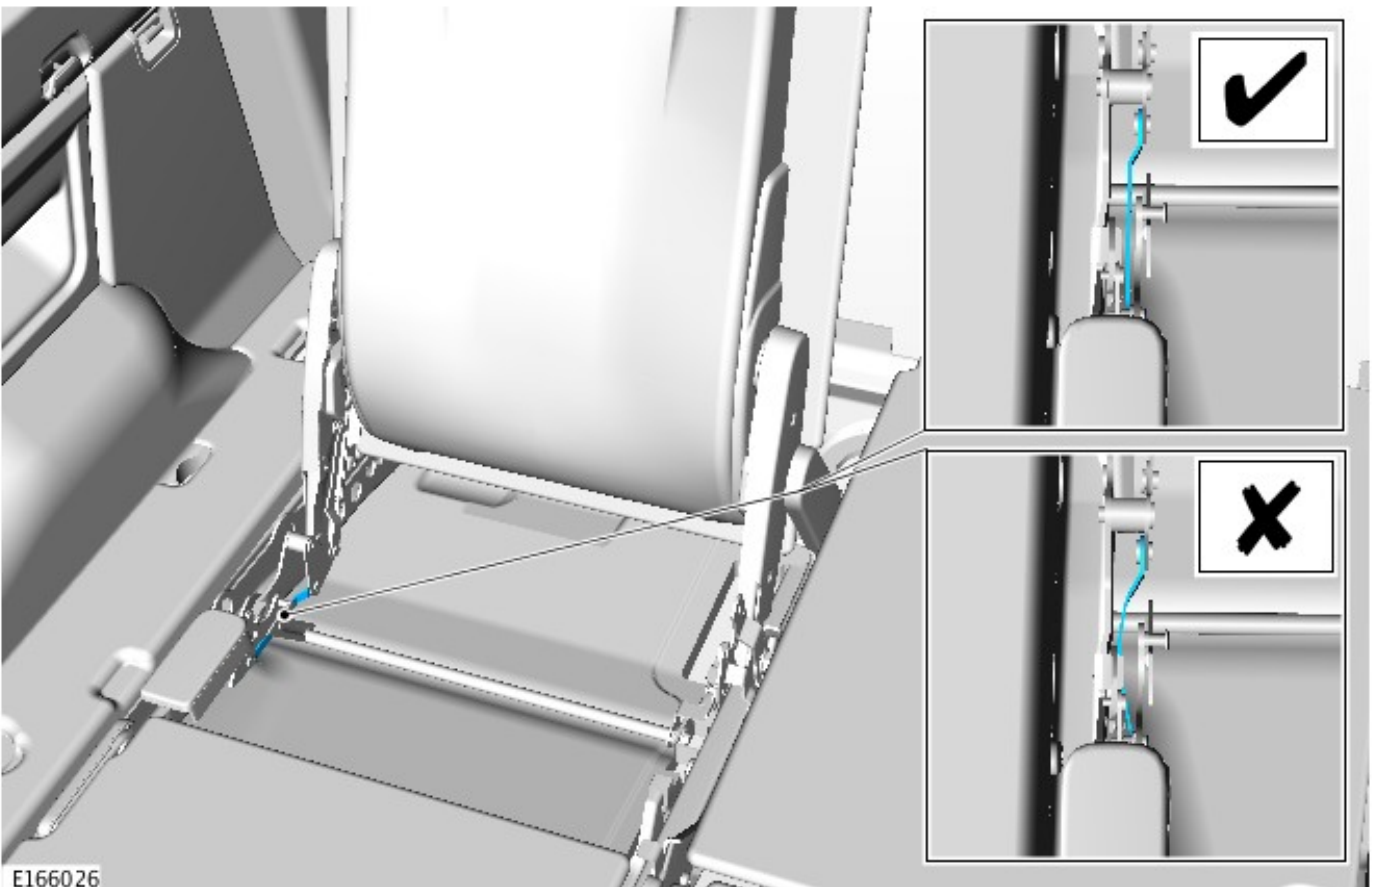

E166026

**3. Check the operation of the occasional seat and repeat the above steps for the other side.**